


Quick Reference Guide V5.16

Menu Navigation




Guardian G6 XL "Hotkeys"

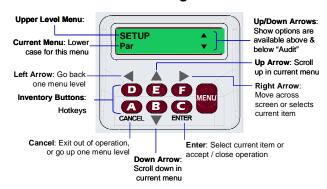

Guardian G6XL Cassette Configurations									
Cassette	Country	Coin Denomination By Tube							
		Α	В	С	D	E	F		
BB	Poland	0.10 zł	1.00 zł	2.00 zł	0.10 zł	0.20 zł	0.50 zł		

Quick Set Up Guide

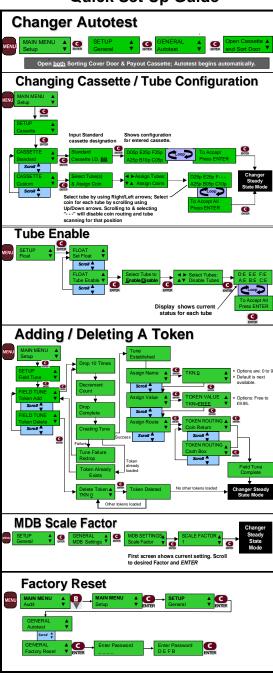

Warning Messages The Scriing Door has not been closed properly.

Display

Sort Door Open

Cassette Door Oper

Tube X

Tube X

Out-of-Service

Communication

Out-of-Service

Tube Sense

The Payout Cassette has not been closed properly.

The noted coin tube has had a payout problem.

Remove the Payout Casette, check that tube and the payout drive belt assembly.

The noted coin tube level reading is inaccurate due to some interference. Please check for any obstructions.

Low Power

Condition

Power to the changer has dropped below the recommended MDB power level.

The changer has an unknown Payout Cassette or tube configuration and cannot route coins. Please see Cassette Configuration.

Check Coin Path

There is a problem in the Acceptor Validation or Sorting area and threes should be checked. Cleaning is most likely required.

Sorting Error

There is a problem in the Sorting section. Please open the Sorting Door and check the area. After correction, drop coins to clear the warning message.

The Escrow Lever is depressed enough to open the acceptor gate or there is a jam in the Acceptor Validation area. Please check these areas.


Out Of Service Messages



There are multiple tube sense errors and the changer is not operational. Please take it to a Colinco authorized Service Cauting for service.


The changer has a Payout Motor problem and is not operational.

Please take it to a Colinco authorized Service Center for service.

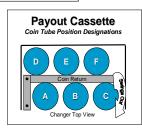

Tube	Capacity	
Denomination	No. Coins	Value
0.10 zł	91	9.10 zł
0.20 zł	89	17.80 zł
0.50 zł	86	43.00 zł
1.00 zł	84	84.00 zł
2.00 zł	70	140.00 zł
5.00 zł	71	355.00 zł




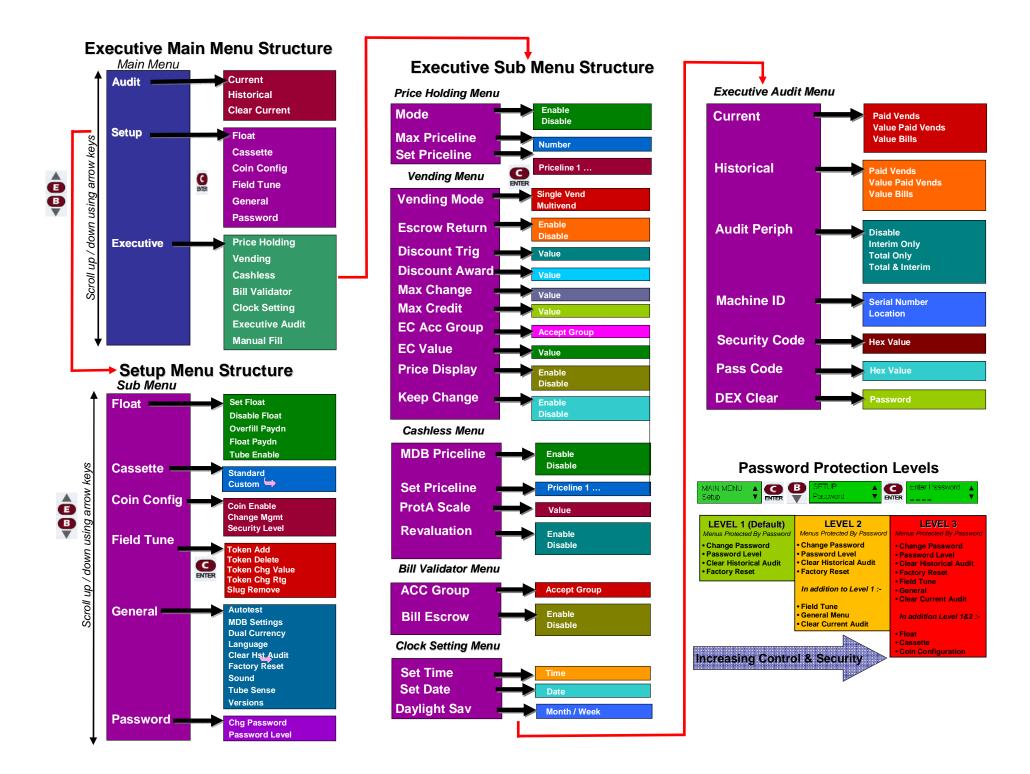




VANTAGE

Engineers Quick Reference Guide V1.1

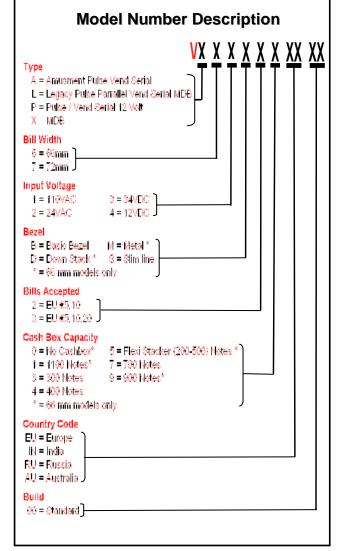



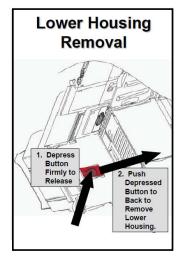







- To reattach, push bill acceptor body firmly onto bezel until it locks.

Cleaning The Vantage

The vantage should be cleaned every 2000 bills or 2 years, depending on environmental conditions. Remove dust with a soft brush - cloth or blow out using compressed air.



Vantage Bill Acceptance								
Model	Bill Width	10.00 zł	20.00 zł	50.00 zł	100.00 zł			
VX73B43PL00	72mm	✓	√	√	✓			

